

# Technical BULLETIN

©2014 YAMAHA MOTOR CORPORATION, U.S.A.


## ALL 2014 SR VIPER MODELS Reverse Actuator Extension Update Kit

### i

### INTRODUCTION

**Symptom:** In affected 2014 SR Viper models it is possible for the reverse actuator to shift out of forward gear which may cause gear damage.

**Remedy:** Install a new Actuator Extension Update Kit. Instructions are included in the kit and provided in this bulletin.

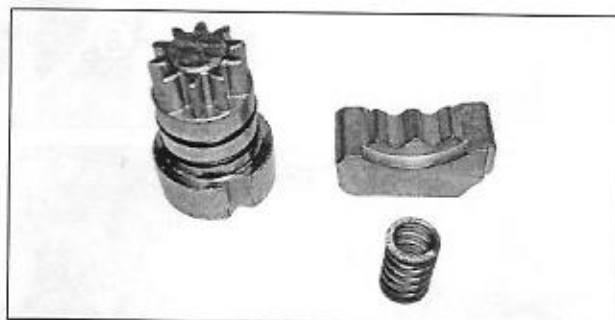

### DEALER ACTION SUMMARY

#### Unsold

**Units:** Modify all affected units during set-up and pre-delivery inspection. Check first to be sure the modification has not already been done. See *Identification Procedure* section.

#### Sold

**Units:** Modify all units in the affected range within their factory warranty period. Check first to be sure the modification has not already been done. See *Identification Procedure* section (page 4).

Please contact customers to arrange a mutually convenient time to have this modification performed if it has not been done. The modification should be done as soon as possible, but must be done before the factory warranty expires to be covered by this 90-code.

#### Parts

**Required:** Yes, order one Actuator Extension Update Kit for each unit to be modified. See *Parts Information*.

**Warranty:** See the *Warranty Procedure* section.



### AFFECTED RANGE

Model	Description (Code)	Affected Range
SR10REB	SR Viper (8JP01)	8JP00-000101 ~ 000499
SR10RSEL	SR Viper RTX SE (8JW1)	8JW00-000111 ~ 000870
SR10RSER	SR Viper RTX SE (8JW1)	8JW00-000536 ~ 000870
SR10LEB	SR Viper LTX (8JX1)	8JX00-000101 ~ 000823
SR10LSEL	SR Viper LTX SE (8JY1)	8JY00-000710 ~ 001383
SR10LSER	SR Viper LTX SE (8JY1)	8JY00-000111 ~ 000707
SR10XSEL	SR Viper XTX SE (8JR1)	8JR00-000103 ~ 000954
SR10XSER	SR Viper XTX SE (8JR1)	8JR00-000957 ~ 001718